
# Subminiature Coaxial Switch 1.35 mm High, DC to 11 GHz

## MS-156C Series

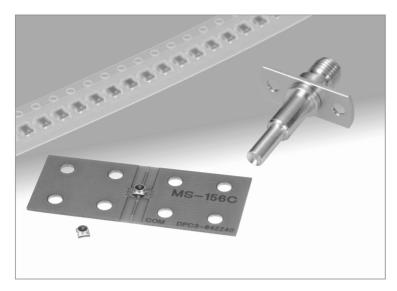

### Features

#### 1. Low insertion loss

0.15 dB typical at 2.5 GHz (not mated with the plug).0.2 dB typical at 6 GHz (not mated with the plug).0.4 dB typical at 11 GHz (not mated with the plug).

## 2. Space-saving design

2.3 mm x 2.3 mm occupied board space.

- **3. Low profile** 1.35 mm protrusion above the board.
- 4. Lightweight

0.014 g. total weight

5. Durability

100 mating/unmating cycles, with corresponding plug.

#### 6. Performs over a wide frequency range Applicable frequencies range over a wide band, from DC to 11 GHz.

7. Board placement with automatic equipment Packaged on tape-and-reel. Also available with a vacuum pick-up cap over each switch.

#### 8. Halogen Free


Chlorine, and bromine are not used in the receptacles. \*Definition according to IEC 61249-2-21. Br 900 ppm max., CI 900 ppm max., and Br + CI 1500 ppm max.

#### Overview

Developed for inspection of high frequency circuits used in portable terminals.Verification of the circuit performance is accomplished by simply inserting the external plug in the board mounted receptacle.This action re-directs the circuit from normal condition to the plug side. Removing the plug restores circuit to its normal condition.

**Halogen Free** 



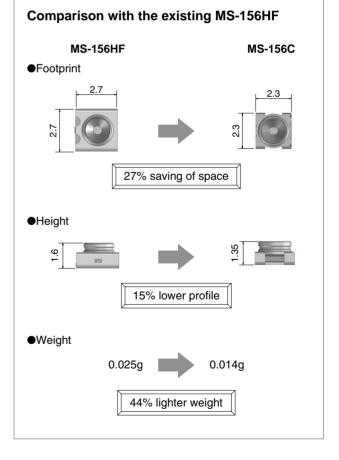

## ■Specifications


	Not mated with the plug	Mated (MS-156-HRMJ-3)
Operating temperature range	-40℃ to +85℃	-40℃ to +85℃
Rated power	2W	2W
Frequency range	DC to 11GHz	DC to 8GHz
	1.2 max. (DC to 2.5GHz)	1.4 mov (DC to 2.0011-)
V.S.W.R.	1.3 max. (2.5GHz to 6.0GHz)	1.4 max. (DC to 3.0GHz)
	1.5 max. (6.0GHz to 11.0GHz)	1.8 max. (3.0GHz to 8.0GHz)
	0.15 dB max. (DC to 2.5GHz)	0.5 dB max. (DC to 3.0GHz)
Insertion loss	0.2 dB max. (2.5GHz to 6.0GHz)	0.8 dB max. (3.0GHz to 6.0GHz)
	0.4 dB max. (6.0GHz to 11.0GHz)	0.9 dB max. (6.0GHz to 8.0GHz)
	20 dB min. (DC to 3.0GHz)           solation           15 dB min. (3.0GHz to 6.0GHz)	
Isolation		
	12 dB min. (6.0GHz to 11.0GHz)	

Item	Specification	Conditions
1. Contact resistance	100 mΩ max.	100 mA max.
2. Insulation resistance	1000 MΩ min.	100 V DC
3. Withstanding voltage	No flashover or insulation breakdown	100 V AC / 1 minute
4. Vibration		Frequency:10 to 55 Hz, single amplitude of
4. VIDIALION	No electrical discontinuity of 1 $\mu$ s or more	0.75 mm, 2 hours in each of the 3 axis.
5. Shock	No electrical discontinuity of $1 \mu s$ of more	Acceleration of 490 m/s <sup>2</sup> , 6 ms duration, sine half-
5. 5HOCK		wave waveform, 3 cycles in each of the 3 axis
	Contact resistance: 100 mΩ max.	Temperature: $-55^{\circ}C \rightarrow +5^{\circ}C$ to $+35^{\circ}C \rightarrow +85^{\circ}C \rightarrow +5^{\circ}C$ to $+35^{\circ}C$
6. Temperature cycle	Insulation resistance: 10 M $\Omega$ min.	Time: $30 \rightarrow 5$ max. $\rightarrow 30 \rightarrow 5$ max. (Minutes)
		50 cycles
7 High temperature expecture	Contact resistance: 100 mΩ max.	96 hours at 85℃
7. High temperature exposure	Insulation resistance: 10 MΩ min.	
	Contact resistance: 100 mΩ max.	96 hours at -55℃
8. Low temperature exposure	Insulation resistance: 10 M $\Omega$ min.	96 hours at -55 C
0. Humidity	Contact resistance: 100 mΩ max.	$00$ hours at $10 \pm 0^{\circ}$ , and humidity of $00$ to $05^{\circ}$
9. Humidity	Insulation resistance: 10 MΩ min.	96 hours at $40\pm2^{\circ}$ C, and humidity of 90 to 95%
10. Durability (mating/un-mating,	Contact resistance: 100 mΩ max.	
with corresponding plug)		100 cycles


Note 1: Information contained in this catalog represents general requirements for this Series. Contact us for the drawings and specifications for a specific part number shown.

## ■Materials


Part	Material	Finish	Remarks
Shell	Phosphor bronze	Gold plated	
Insulator	6T Nylon		UL94HB
Common terminal	Cu-Ni-Si alloy	Selective gold plated	
Antenna terminal	Phosphor bronze	Selective gold plated	

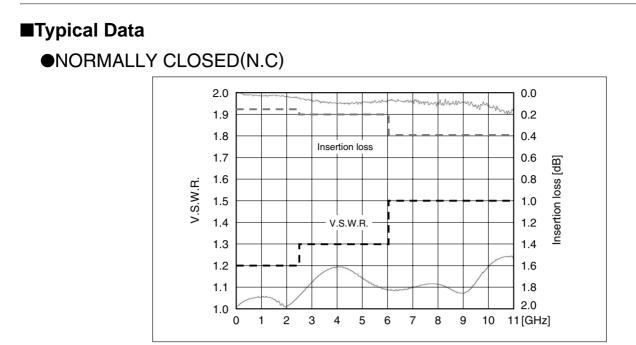

## NORMALLY OPEN(N.O)

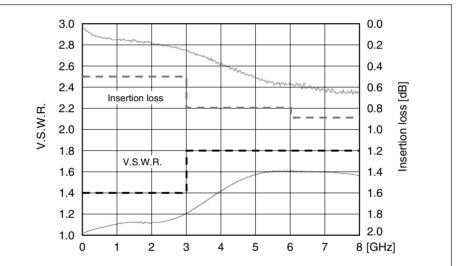

**•**ISOLATION

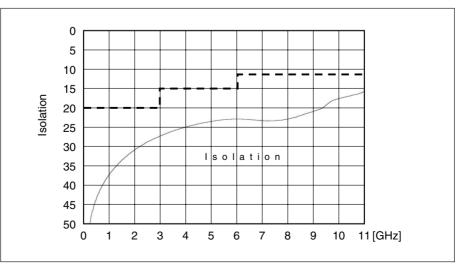



## **■**Receptacle





Part Number	CL No.	Packaging
MS-156C	358-0251-2	10,000 pieces/reel
MS-156C(20)	358-0251-2-20	2,000 pieces/reel

## ■Circuit diagram



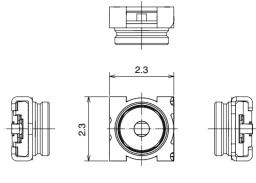




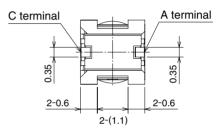

## ■PCB mounting pattern and metal mask dimensions


- \* Request drawing of the specific part for exact dimensions and tolerances.
- \* Specified dimensions must be followed to assure correct board placement and performance.

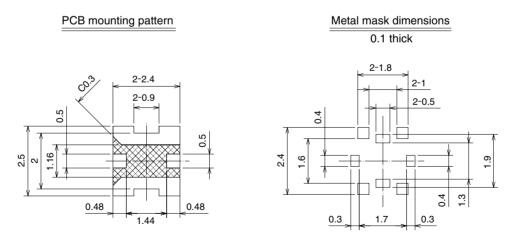

This area must be free of conductive traces and resist field.

## Precautions

- 1. This product is intended to be used for circuit inspection only. Consult us if any other application is considered.
- 2. Cross-hatched area shown on the PCB mounting pattern must be free of any conducive traces. Placing conductive traces in this area may affect performance and will void product warranties. When the bottom surface of the product (i.e., the shaded area of the specified land dimensions diagram on the previous page) has been processed with a subtrate copper trace and resist processing, Hirose Electric will not be able to warrant the product.
- 3. Do not use hand soldering for mounting of MS-156C. Doing so could result in solder and flux wicking to the contact areas.
- 4. Exercise caution as not to allow any debris to enter the board mounted MS-156C when cutting PCB.

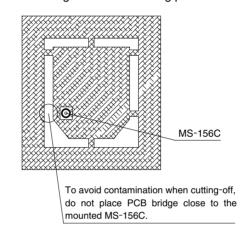



Recommended Mounting of MS-156C coaxial switch on the PCB during the manufacturing process


- 5. Do not use the washing process.
- 6. Please refrain from using the product in environments specifically affected by excessive vibration, shock, dust, high humidity, gases, very high temperatures and very low temperatures such as outdoor equipment. It might cause degradation or destruction of the product. Even if it endures during a short time, long time quarification is not quaranteed.
- 7. For use of this product, be sure to put contact area of plug on position P(P4 full view) perpendicularly.
- 8. Plugs can be roughly classified to two types.
  - For mass production line automatic check (Press down type)
  - For manual check (With retentive lock) : Unable to be used at production line.
- 9. When automatic inspections are to be performed during the manufacturing operations, request the MS-156 plug connector manual for examples of implementation.

## ■Packaging Specifications

#### ●MS-156C

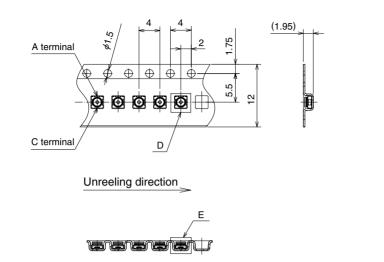


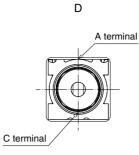




Е

#### Reel dimentions

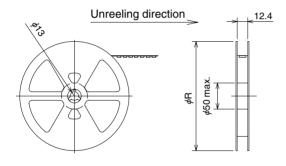

Part Number	Reel Size	Packaging
MS-156C	R = <i>ø</i> 380mm	10,000 pieces/reel
MS-156C(20)	R = <i>ø</i> 180mm	2,000 pieces/reel

## ■Recommended Temperature Profile

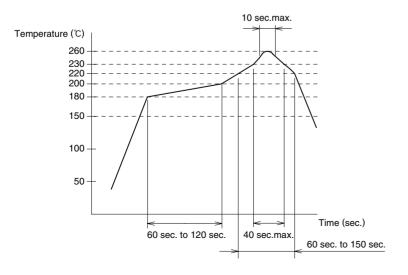


Using Lead-free	Solder paste
-----------------	--------------

Maximum temperature	: 260°C
Peak temperature time	: 10 sec. max.
<b>3</b> 230℃ min.	: 40 sec. max.
<b>④</b> 220℃ min.	: 60 sec. to 150 sec.
⑤ 180℃ to 200℃	: 60 sec. to 120 sec.
Metal mask thickness Reflow cycles	: 0.1 mm : 2 cycles

# PlugsPress down, right angle



Simplified lock, right angle, short

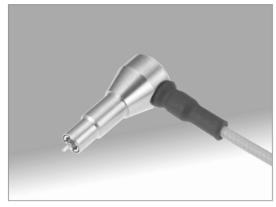


#### Simplified lock, right angle, long




●Simplified lock, right angle, for antenna



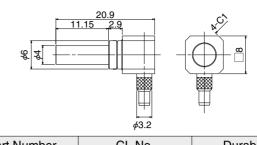

Part Number	CL No.	Durability
MS-156-C(LP)-1	358-0173-0	10,000 Times


Applicable cable: 1.5D-HQEW, 1.5D-QEW (Fujikura Ltd.)

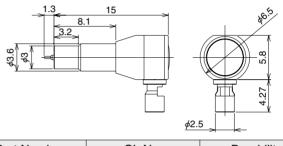

Part Number	CL No.	Durability
MS-156-088LP-H1	358-0268-5	500 Times

Applicable cable: DFS111-UL1979(Junkosha Ltd.)


Please contact Hirose Sales Representative for cable length and cable end treatment.

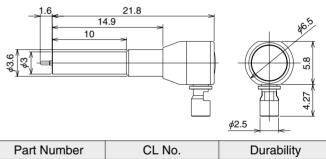

 MS-156-088LP-H2
 358-0275-0
 500 Times

 Applicable cable: DFS111-UL1979(Junkosha Ltd.)

Please contact Hirose Sales Representative for cable length and cable end treatment.

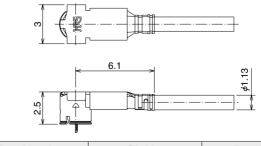

Part Number	CL No.	Durability
MS-156C-LP-068	358-0276-3	30 Times


Applicable cable: KHCX-32AWG-SB-TA(Showa Electric Wire & Cable Co., Ltd.) Please contact Hirose Sales Representative for cable length and cable end treatment.

## ■SMA Conversion Adapters







Press down, with flange, short

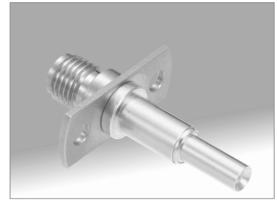


#### Press down, with flange, long

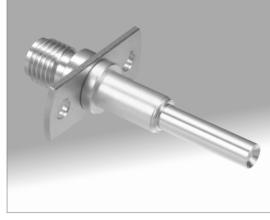


•Press down, with flange, right angle

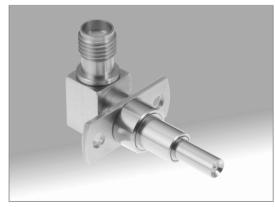


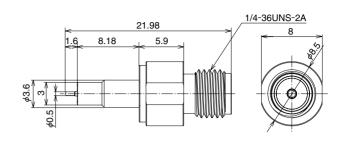


Part Number	CL No.	Durability
MS-156-HRMJ-H1	358-0290-4	500 Times

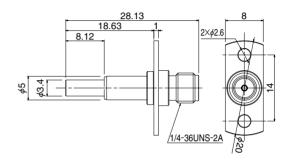

Part Number	CL No.	Durability
MS-156-HRMJ-3	358-0171-5	10,000 Times

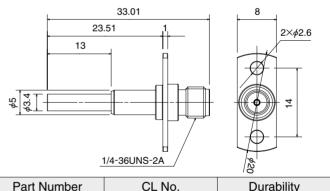

Part Number	CL NO.	Durability
MS-156-HRMJ-14	358-0198-1	10,000 Times

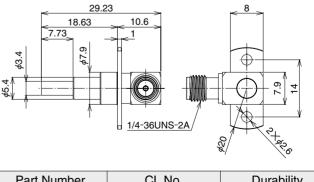

Part Number	CL No.	Durability
MS-156LP-HRMJ-8	358-0289-5	100,000 Times

•Floating (Self-Pressing)




•Floating (Self-Pressing)




#### •Floating (Self-Pressing)




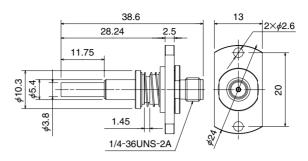

Part Number	CL No.	Durability
MS-156-HRMJ-10	358-0194-0	10,000 Times

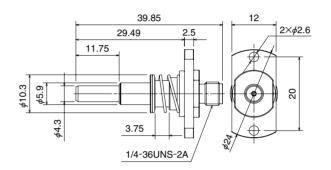

Part Number	CL No.	Durability
MS-156-HRMJ-12	358-0196-6	10,000 Times

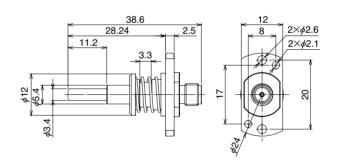


Part Number	CL No.	Durability
MS-156-HRMJ-29	358-0295-8	200,000 Times

# ■Adapter for plug inspection

•SMA Conversion Adapter




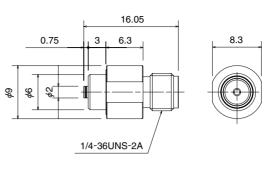

Part Number	CL No.	Durability
MS-156R-HRMJ-1	358-0188-8	500 Times

### **•**N Conversion Adapter



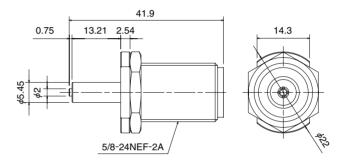

Part Number	CL No.	Durability
MS-156R-NJ-1	358-0176-9	500 Times